

Multivariate Control Charts based on Bayesian State Space Models

K. Triantafyllopoulos*

31 January 2006

Abstract

This paper develops a new multivariate control charting method for vector autocorrelated and serially correlated processes. The main idea is to propose a Bayesian multivariate local level model, which is a generalization of the Shewhart-Deming model for autocorrelated processes, in order to provide the predictive error distribution of the process and then to apply a univariate modified EWMA control chart to the logarithm of the Bayes' factors of the predictive error density versus the target error density. The resulting chart is proposed as capable to deal with both the non-normality and the autocorrelation structure of the log Bayes' factors. The new control charting scheme is general in application and it has the advantage to control simultaneously not only the process mean vector and the dispersion covariance matrix, but also the entire target distribution of the process. Two examples of London metal exchange data and of production time series data illustrate the capabilities of the new control chart.

Some key words: time series, SPC, multivariate control chart, state space model, EWMA.

1 Introduction

In the last decades multivariate Statistical Process Control (SPC) has received considerable attention, since in practice many processes are observed in a vector form (Montgomery¹). Univariate control charts have been extensively discussed in the literature (Montgomery¹, Box and Luceño², del Castillo³) and many efforts have been devoted to upgrading the control charts for: (a) cases of correlated univariate processes; and (b) cases of multivariate uncorrelated processes.

Multivariate control charting has been discussed in many studies, e.g. Tracy *et al.*⁴, Liu⁵, Kourti and MacGregor⁶, Mason *et al.*⁷, Vargas⁸, Ye *et al.*⁹ and Pan¹⁰ among many others. Review papers on multivariate control charts include Lowry and Montgomery¹¹, Sullivan and Woodall¹², Montgomery and Woodall¹³, Bersimis *et al.*¹⁴ and Yeh *et al.*¹⁵. Most of the current research has been focused on the Hotelling's T^2 control chart and the multivariate EWMA control chart for controlling the process mean. Yeh *et al.*¹⁶, Surtihadi *et al.*¹⁷, Cheng and Thaga¹⁸ and Costa and Rahim¹⁹ propose and study multivariate EWMA and CUSUM control charts to control the dispersion of a multivariate process. As stated before univariate control charts for autocorrelated processes have been discussed in the literature

*Department of Probability and Statistics, Hicks Building, University of Sheffield, Sheffield S3 7RH, UK, Email: k.triantafyllopoulos@sheffield.ac.uk, Tel: +44 114 222 3741, Fax: +44 114 222 3759.

(Montgomery¹, Box and Luceño²), however, for multivariate processes the general focus has been placed to uncorrelated processes. Dyer *et al.*²⁰, Jiang²¹, Kalgonda and Kulkarni²² and Noorossana and Vaghefi²³ consider multivariate control charting for autocorrelated processes based on autoregressive-moving-average (ARMA) time series models and the T^2 and multivariate CUSUM control charts are illustrated. Pan and Jarrett²⁴ build a multivariate T^2 control chart for the forecast errors of the process. They consider a state-space approach for modelling the underlying process and they point out that the problem of monitoring multivariate processes is a problem of multivariate time series forecasting as well as a problem of control charting. Some forms of Bayesian control charts, known also as adaptive or dynamic control charts, are discussed in Tagaras²⁵, Tagaras and Nikolaidis²⁶, de Magalhães *et al.*²⁷ and in references therein. Adaptive control charts offer the flexibility and versatility to dynamically change the sampling size and the sampling interval of a Shewhart control chart, but they are disadvantaged in that the complexity is increased and usually the modeller has to resort to Monte Carlo simulation.

Our aim in this paper is to construct a multivariate control chart for autocorrelated processes in such a way that the scheme will be capable to monitor the process mean vector only, the process dispersion covariance matrix only, or both the process mean vector and the process dispersion covariance matrix. We propose a new control chart based on the theory of sequential Bayes' factors (West and Harrison²⁸). First we fit a local level model to the multivariate process and then we apply a univariate modified EWMA control chart to the logarithm of the Bayes' factor to monitor the dispersion of the predictive distribution of the data from the target distribution. Our model makes use of a generalization of the Shewhart-Deming model for multivariate autocorrelated processes (Deming²⁹, del Castillo³, Triantafyllopoulos *et al.*³⁰).

Section 2 gives the necessary time series background. The proposed control chart is discussed in detail in Section 3. In Sections 4 and 5 two examples, consisting of data from the London metal exchange and from a production of a plastic mould, illustrate the methodology and give light to the design and implementation of the new control chart. Concluding comments are given in Section 6 and the appendix details a proof of an argument in Section 3.

2 Background

The conventional control charts are based on the Shewhart-Deming model, e.g. for a $p \times 1$ process vector y_t this model sets

$$y_t = \mu + \epsilon_t, \quad \epsilon_t \sim \mathcal{N}_p(0, \Sigma), \quad (1)$$

where μ is the process mean vector and Σ is the process dispersion covariance matrix, known also as the measurement covariance matrix. Here $\mathcal{N}_p(0, \Sigma)$ indicates the p -dimensional normal distribution with mean vector zero and covariance matrix Σ . The measurement drift sequence $\{\epsilon_t\}$ is assumed uncorrelated and this makes the generating process $\{y_t\}$ an uncorrelated sequence too. In this paper we extend the above model by considering equation (1), but now μ is replaced by a time-dependent μ_t , which follows a multivariate random walk model, known also as local level model (Durbin and Koopman³¹).

Discount Weighted Regression (DWR), which originated in the path-breaking work of Brown³², is a method for forecasting autocorrelated time series. Considering univariate time

series Ameen and Harrison³³ developed further DWR for more complex time series. The reviews of Ameen³⁴ and Goodwin³⁵ suggest that DWR can model efficiently time series in a wide range of situations. Triantafyllopoulos and Pikoulas³⁶ developed a multivariate version of DWR and these authors focused on the estimation of the measurement covariance matrix. In this paper we consider the DWR method of Triantafyllopoulos³⁷ for multivariate local level models defined by

$$y_t = \mu_t + \epsilon_t \quad \text{and} \quad \mu_t = \mu_{t-1} + \omega_t, \quad (2)$$

where $\epsilon_t \sim \mathcal{N}_p(0, \Sigma)$ and $\omega_t \sim \mathcal{N}_p(0, \Omega_t \Sigma)$. The scalar Ω_t is specified with the aid of a discount factor δ and the sequences $\{\epsilon_t\}$ and $\{\omega_t\}$ are mutually and individually uncorrelated, e.g. $\mathbb{E}(\epsilon_i \epsilon_j') = \mathbb{E}(\omega_k \omega_\ell') = \mathbb{E}(\epsilon_r \omega_s') = 0$, for all $i \neq j$, $k \neq \ell$ and for all r, s . Here $\mathbb{E}(\cdot)$ denotes expectation and ϵ_j' denotes the row vector of ϵ_j . The model definition is complete by specifying a prior distribution $p(\mu_0 | \Sigma)$, which is usually the p -dimensional normal distribution, e.g. $\mu_0 | \Sigma \sim \mathcal{N}_p(m_0, P_0 \Sigma)$, for some known prior mean vector m_0 and a positive scalar $P_0 > 0$. It is further assumed that μ_0 is uncorrelated of all ω_t . For some positive integer $N > 0$, let $y^t = (y_1, y_2, \dots, y_t)$ be the information set comprising data up to and including time t , for $t = 1, 2, \dots, N$.

With the prior $\mu_0 | \Sigma \sim \mathcal{N}_p(m_0, P_0 \Sigma)$, the posterior density of $\mu_t | \Sigma, y^t$ is $\mu_t | \Sigma, y^t \sim \mathcal{N}_p(m_t, P_t \Sigma)$, where m_t and P_t are updated by

$$m_t = m_{t-1} + \frac{P_{t-1}}{\delta + P_{t-1}} e_t = \frac{\delta m_{t-1} + P_{t-1} y_t}{\delta + P_{t-1}} \quad \text{and} \quad P_t = \frac{1}{\delta + P_{t-1}}, \quad (3)$$

with $e_t = y_t - \mathbb{E}(y_t | y^{t-1}) = y_t - m_{t-1}$ being the one-step forecast error vector at time $t - 1$. Define the residual error vector $r_t = \mathbb{E}(\epsilon_t | y^t) = y_t - m_t$. For each time t the estimator S_t of Σ is achieved by least squares estimation as

$$S_t = \frac{1}{t} \sum_{i=1}^t r_i e_i' = \frac{1}{t} \sum_{i=1}^t \frac{\delta e_i e_i'}{\delta + P_{i-1}}, \quad (4)$$

after observing that

$$r_t = y_t - m_t = y_t - m_{t-1} - \frac{P_{t-1} e_t}{\delta + P_{t-1}} = e_t - \frac{P_{t-1} e_t}{\delta + P_{t-1}} = \frac{\delta e_t}{\delta + P_{t-1}}.$$

Details of the derivations of m_t , P_t and S_t appear in Triantafyllopoulos and Pikoulas³⁶ and Triantafyllopoulos³⁷.

From the above it follows that the one-step forecast density is

$$y_{t+1} | \Sigma = S_t, y^t \sim \mathcal{N}_p \left\{ m_t, \frac{(\delta + P_t) S_t}{\delta} \right\}$$

and the corresponding one-step forecast error density is

$$e_{t+1} | \Sigma = S_t, y^t \sim \mathcal{N}_p \left\{ 0, \frac{(\delta + P_t) S_t}{\delta} \right\}, \quad (5)$$

where $e_{t+1} = y_{t+1} - \mathbb{E}(y_{t+1} | y^t) = y_{t+1} - m_t$.

The adequacy of the model is evaluated via the mean of squared standard one-step forecast error vector (MSSE), the mean of absolute percentage one-step forecast error vector (MAPE)

and the mean of absolute one-step forecast error vector (MAE). These statistics are discussed in Chatfield³⁸ and for data y_1, y_2, \dots, y_N they are defined by

$$MSSE = \frac{1}{N} \sum_{t=1}^N [(e_{1t}^*)^2 \ (e_{2t}^*)^2 \ \dots \ (e_{pt}^*)^2]', \quad e_t^* = \left\{ \frac{(\delta + P_{t-1})S_{t-1}}{\delta} \right\}^{-1/2} e_t,$$

$$MAPE = \frac{1}{N} \sum_{t=1}^N \left[\frac{|e_{1t}|}{y_{1t}} \ \frac{|e_{2t}|}{y_{2t}} \ \dots \ \frac{|e_{pt}|}{y_{pt}} \right]', \quad MAE = \frac{1}{N} \sum_{t=1}^N [|e_{1t}| \ |e_{2t}| \ \dots \ |e_{pt}|]'$$

where e_t^* is the standard one-step forecast error, $y_t = [y_{1t} \ y_{2t} \ \dots \ y_{pt}]'$, $e_t = [e_{1t} \ e_{2t} \ \dots \ e_{pt}]'$ and $\{\delta^{-1}(\delta + P_{t-1})S_{t-1}\}^{-1/2}$ denotes the inverse of the symmetric square root of the matrix $\delta^{-1}(\delta + P_{t-1})S_{t-1}$ based on the spectral decomposition of symmetric matrices (Gupta and Nagar³⁹; pages 6-7). If the model fit is good the MSSE should be close to the vector $[1 \ 1 \ \dots \ 1]'$, while MAPE and MAE should be as small as possible in absolute value. Note that the MAPE, as a percentage statistic, makes sense only for a positive valued process y_t , for all t . If this is not the case, then MAPE can not have a meaningful interpretation and it should be excluded from the statistical analysis (Chatfield³⁸).

3 The Bayesian Control Chart

3.1 The Main Idea

Bayes' factors have been extensively discussed in the statistics literature and recently they have been applied sequentially for time series, see e.g. West and Harrison²⁸ (Chapter 11). Salvador and Gargallo⁴⁰ propose a monitoring scheme, based on Bayes' factors, for multivariate time series, but this approach is not suitable for control charting, because it is applied in a model selection problem. In addition to this, most of the Bayesian time series monitoring (including the work of Salvador and Gargallo⁴⁰) relies upon simulated based methods and in particular Monte Carlo simulation. In this paper we favour non-iterative techniques, because they are faster, more flexible and easier to apply.

Once we have the distribution (5) we can construct a target distribution for the dispersion of y_t from the target mean and then compare these two distributions. It is well known (see e.g. Pan and Jarrett²⁴) that the forecast errors e_i and e_j ($i \neq j$) are approximately uncorrelated and the approximation is so good as S_t is closer to Σ . Suppose now that the target mean of $\{y_t\}$ is denoted by μ and the process dispersion covariance matrix is denoted by V . This notation is consistent with the Shewhart-Deming model as in equation (1), with $V = \Sigma$ so that $\mathbb{E}(y_t) = \mu$ and $\text{Var}(y_t) = \Sigma$, where $\text{Var}(y_t)$ denotes the covariance matrix of y_t . It is assumed that μ is a generally unknown vector, but not stochastic. In our model of equation (2) we have $\mathbb{E}(y_t|\mu_t) = \mu_t$ and $\text{Var}(y_t|\mu_t) = \Sigma$, but now μ_t is stochastic and it also changes with time according to the random walk model of (2). We postulate that, if the process is in control, the one step forecast mean of y_t will be close to the target mean vector μ and the forecast covariance matrix of y_t will be close to the target dispersion covariance matrix V . Thus we can define the target error distribution by $\varepsilon_t \sim N_p(0, V)$, where $\varepsilon_t = y_t - \mu$ is the process error, also known in the process adjustment literature (del Castillo³) as disturbance drift. Here we assume that V is positive definite matrix, although the proposed approach can be modified when V is positive semi-definite. According to the above postulate, if model (1) describes well the in-control process, density (5) should be close to the above target distribution. In

order to find out “how close” it is, we form the Bayes’ factor at time t :

$$BF(t) = \frac{f_e(t)}{f_\varepsilon(t)} = \frac{f_e(e_t|\Sigma = S_{t-1}, y^{t-1})}{f_\varepsilon(\varepsilon_t)}, \quad t = 1, 2, \dots, N,$$

where $f_e(t)$ and $f_\varepsilon(t)$ denote the probability density functions of e_t and ε_t , respectively.

For consistency in the above equation we need to make the convention $y^0 = \emptyset$ (the null or empty set). Since both densities $f_e(t)$ and $f_\varepsilon(t)$ are normal we have

$$BF(t) = \sqrt{\frac{\delta^p \det(V)}{(\delta + P_{t-1})^p \det(S_{t-1})}} \exp \left\{ (y_t - \mu)' V^{-1} (y_t - \mu) / 2 - \delta (y_t - m_{t-1})' S_{t-1}^{-1} (y_t - m_{t-1}) / (2\delta + 2P_{t-1}) \right\}, \quad (6)$$

where $\det(\cdot)$ denotes the determinant of a square matrix. The Bayes’ factor $BF(t)$ takes values from 0 to $+\infty$. We will say that the process y_t is in control at time t , if $f_e(t) = f_\varepsilon(t)$, or if $BF(t) = 1$; otherwise the process will be out of control, at this time point. An out of control signal might be caused because of a mean shift (e.g. when $\mathbb{E}(y_t|y^{t-1}) = m_{t-1}$ is significantly different than μ) or because of a dispersion shift (e.g. $\text{Var}(y_t|\Sigma = S_{t-1}, y^{t-1}) = (\delta + P_{t-1})S_{t-1}/\delta$ is significantly different than V).

3.2 The Modified EWMA Control Chart for Correlated Data

A control chart for the Bayes’ factor $BF(t)$ can conclude whether $BF(t)$ is close to 1 and thus whether the process is in control or not. Since $BF(t)$ is positive valued, it is more convenient to work with the logarithm of the Bayes’ factor

$$LBF(t) = \log BF(t) = p \log \delta / 2 + \{\log \det(V)\} / 2 - p \{\log(\delta + P_{t-1})\} / 2 - \{\log \det(S_{t-1})\} / 2 + (y_t - \mu)' V^{-1} (y_t - \mu) / 2 - \delta (y_t - m_{t-1})' S_{t-1}^{-1} (y_t - m_{t-1}) / (2\delta + 2P_{t-1}) \quad (7)$$

and so we can construct an appropriate univariate control chart for $LBF(t)$. In order to propose such a chart we need to deal with two issues: (a) the values of $LBF(t)$ will be serially correlated and (b) the distribution of $LBF(t)$ might not be normal.

Considering (a), in our development it is clear that, from the definition of the $BF(t)$, either the original data y_t are i.i.d. or auto-correlated, the resulting data $BF(t)$ (or $LBF(t)$) will be correlated and hence, if the Shewhart or any other control chart is to be used successfully, they should be modified appropriately to accommodate for correlated observations. Many authors have demonstrated that the Shewhart control charts need to be modified in order to cater for serially correlated observations (Vasilopoulos and Stamboulis⁴¹; Schmid⁴²). Similarly, the EWMA needs also to be modified and the resulting modified EWMA control chart has been discussed in many articles including Schmid⁴³ and VanBrackle and Reynolds⁴⁴. According to Harris and Ross⁴³ ignoring serial correlation has a stronger effect in EWMA than in the Shewhart control chart, but as we will see later the EWMA control chart is preferable to Shewhart, because it is more robust to the assumption of normality. One could also consider the modified CUSUM chart for correlated observations, but we will not further discuss this in the present paper.

Proceeding with (b) one needs to check the assumption of normality, before applying a modified EWMA (or Shewhart or CUSUM) control chart. Borrer *et al.*⁴⁶ studied the ARL

performance of the EWMA and they suggested that the EWMA with a smoothing parameter equal to 0.05 is very effective, even in the presence of non-normality of the observations. This result agrees with Montgomery¹ who states for the EWMA “It is almost a perfectly non-parametric (distribution free) procedure”. Maravelakis *et al.*⁴⁷ study the robustness to normality of the EWMA by tabulating characteristics of the run length distributions (e.g. ARL) for observations generated by several gamma distributions. These results conclude that, for relatively low values of the damping parameter of the EWMA and for shifts in the mean the EWMA control chart can be used, even in the absence of normality. Moreover, if the process is in-control following a symmetrical, but not normal, distribution, then the EWMA can be applied successfully. To the following we look at the empirical distribution of $LBF(t)$ when the process is in control and when it is out of control.

We generate 1000 vectors from a bivariate normal distribution $\mathcal{N}_2(\mu, V)$ with

$$\mu = \begin{bmatrix} 0 \\ 0 \end{bmatrix} \quad \text{and} \quad V = \begin{bmatrix} 1 & 2 \\ 2 & 5 \end{bmatrix}$$

and we generate 1000 vectors for three out of control scenarios. In scenario 1 we simulate data from $\mathcal{N}_2(\mu_d, V)$ (deviations from the mean μ); in scenario 2 we simulate data from $\mathcal{N}_2(\mu, V_d)$ (deviations from the covariance matrix V); in scenario 3 we simulate data from $\mathcal{N}_2(\mu_d, V_d)$ (deviations from both μ and V), where

$$\mu_d = \begin{bmatrix} 0.5 \\ 0 \end{bmatrix} \quad \text{and} \quad V_d = \begin{bmatrix} 1 & 2.5 \\ 2.5 & 8 \end{bmatrix}.$$

Figure 1 shows the histograms of the $LBF(t)$ for the above four scenarios (one in control and three out of control scenarios). From this figure we observe that, although the distribution of the $LBF(t)$ for the in-control process (panel (a) in Figure 1) is not-normal, it is roughly symmetric. The distributions of the $LBF(t)$ for the out of control processes appear to be slightly skewed, but the histograms are not conclusive. The important point is the non-normality of the $LBF(t)$ and the symmetry of the distribution of the in-control process. This enables us to make use of the modified EWMA control chart, but we note that the modified CUSUM control chart can also be used. A more formal confirmation of the non-normality of the distribution of $LBF(t)$ can be carried out by the using standard tests of normality, however, here the histograms are deemed sufficient to declare the non-normality of the distribution of $LBF(t)$.

We use a two phase control scheme; in Phase I the mean μ and the covariance matrix Σ are estimated and adjustments are applied if necessary, while in Phase II the EWMA control chart is applied to detect any changes in the mean of $LBF(t)$. Thus we propose the algorithm:

Algorithm 1. *There are two phases:*

Phase I: *We fit the DWR model (2) for a set of historical data $t = 1, 2, \dots, N^*$, with $N^* < N$. We check the performance and adequacy of the model via the MSSE, MAPE and MAE over all $t = 1, 2, \dots, N^*$ and we possible apply adjustments to the DWR model, (e.g. adjustments in the mean level) so that we obtain optimal values $m_{opt} = m_{N^*}$, $S_{opt} = S_{N^*}$, $\delta = \delta_{opt}$ ensuring that in Phase I the model matches the in-control process. The modified EWMA control chart is applied so that control limits are adequately defined according to pre-specified ARL curves. For this to be designed, a state-space model for the process $LBF(t)$ needs to be identified and here simple AR and ARMA modelling will be generally acceptable.*

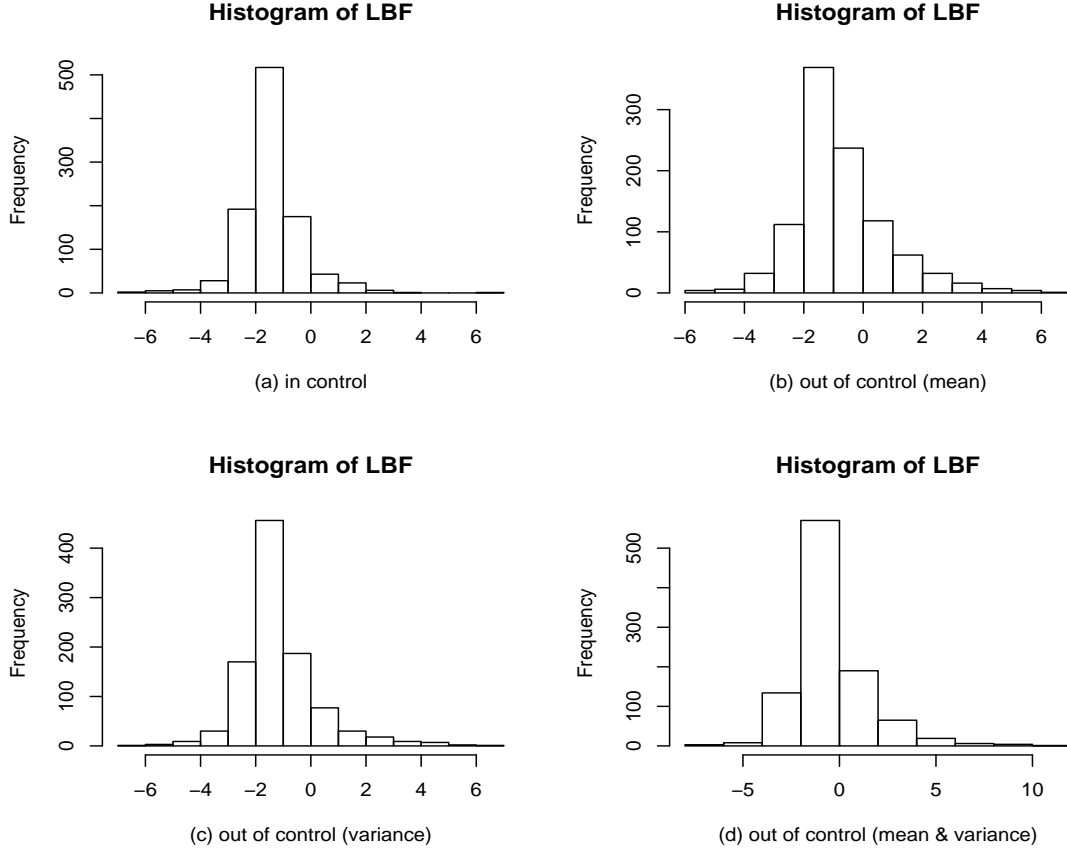


Figure 1: Histograms of the log Bayes' factor $LBF(t)$ for an in-control process (panel (a)) and out-of-control processes (panels (b)-(d)). The out of control scenarios considered are deviations from the mean vector (panel (b)), deviations from the covariance matrix (panel (c)) and deviations from both the mean vector and the covariance matrix (panel (d)).

Phase II: We fit the DWR model with the model components from Phase I (e.g. $\delta = \delta_{opt}$, $m_t = m_{opt}$, $\Sigma = S_{opt}$ and we apply a modified EWMA control chart at observations $LBF(t)$ with the control limits identified at Phase I, for $t = N^* + 1, N^* + 2, \dots, N$.

In order to apply the modified EWMA control chart we first calculate the series z_t with observations $x_t = LBF(t)$ as

$$z_t = \lambda x_t + (1 - \lambda)z_{t-1}, \quad 0 < \lambda \leq 1. \quad (8)$$

The parameter λ is the EWMA smoothing parameter and as it is mentioned above, for $\lambda = 0.05$ or $\lambda = 0.1$ the control chart is robust to normality. Then, the control limits of the modified EWMA control chart are

$$\mu_z \pm c\sigma_z, \quad (9)$$

where $\mu_z = \mathbb{E}(z_t)$, $\sigma_z^2 = \lim_{t \rightarrow \infty} \text{Var}(z_t)$ (asymptotic variance of z_t) and $c > 0$ is determined according to the required ARL. For AR(1) dependence $x_t = \phi x_{t-1} + \nu_t$ and for large t , the

asymptotic variance σ_z^2 is

$$\sigma_z^2 = \frac{\sigma^2 \lambda \{1 + \phi(1 - \lambda)\}}{(1 - \phi^2)(2 - \lambda)\{1 - \phi(1 - \lambda)\}},$$

where $\nu_t \sim \mathcal{N}(0, \sigma^2)$ and σ^2, ϕ are assumed known. In practice these parameters are estimated at Phase I. According to Schmid⁴³ the asymptotic variance σ_z^2 performs better than the exact variance of z_t , which is given in Schmid⁴³ and which produces time-dependent control limits. Most of the literature on this topic focuses on deriving the variance σ_z^2 assuming simple time series models for x_t , e.g. as in the above AR(1) or as in the ARMA(1,1) model considered in VanBrackle and Reynolds⁴⁴.

Algorithm 1 can be simplified, if at Phase I, the quantities P_t and S_t converge to stable values and these values are determined in Phase I for both phases. This brings up a well known problem, which has received considerable attention in the time series literature (see e.g. Durbin and Koopman³¹). However, for the DWR and similar multivariate models limiting results for P_t and S_t have not been yet established. The next theorem (which proof is in the appendix) states that P_t and S_t converge to stable limiting values.

Theorem 1. *In the DWR model (2) the estimator S_t of the measurement covariance matrix Σ converges in probability to Σ and the non-stochastic scalar parameter P_t converges to the limit $P = (\sqrt{\delta^2 + 4} - \delta)/2$, i.e. $S_t \xrightarrow{P} \Sigma$ and $P_t \rightarrow P$.*

From Theorem 1 the estimator S_t is consistent and from the proof of this theorem (given in the appendix), S_t is also unbiased estimator. Theorem 1 suggests that P_{t-1} in the calculation of $LBF(t)$ of equation (7) can be replaced by its limit P . From equation (3) and Theorem 1, the forecast of y_t, m_{t-1} can be approximated by

$$m_{t-1} = m_0 + \frac{P}{\delta + P} \sum_{i=1}^{t-1} e_i = m_0 + \frac{\sqrt{\delta^2 + 4} - \delta}{\sqrt{\delta^2 + 4} + \delta} \sum_{i=1}^{t-1} e_i,$$

where P_{t-1} of equation (7) is replaced by P . Figure 2 shows how fast $\{P_t\}$ converges to its limit P , for a prior $P_0 = 1/1000$ and three values of δ . This figure points out that P_t is bounded above by 1, but for $\delta = 0.2$, this bound is only achieved after $t > 13$ (solid line in Figure 2), while for $\delta = 0.9$, this bound is achieved for any $t > 1$ (dotted line in Figure 2). This gives an empirical indication of the speed of convergence of $\{P_t\}$, for several values of δ .

The limit P is known before the algorithm starts (e.g. P depends only on δ) and, given enough data in Phase I, the limit Σ can be approximated by $\Sigma \approx S_{N^*}$, in the end of Phase I. This can have an additional benefit on computational savings, but more importantly it gives a theoretical justification that the DWR produces a good copy of the process $\{y_t\}$ and therefore this model is appropriate for the monitoring part at Phase II of Algorithm 1. For example, if P_t and S_t were not converging to stable values, no matter how many data we collected at Phase I, the covariance matrix of y_t and thus its uncertainty would change over time resulting in an unstable time series model. False alarms are probable in the framework of such unstable models, which should be avoided.

In the design and application of the control chart it is important to suggest values of m_0, P_0, δ and S_0 and to study their sensitivity and influence to the performance of the proposed control chart. Since these suggestions are related to forecasting as in equation (5), results on the sensitivity of such prior parameters follow from Triantafyllopoulos and Pikoulas³⁶ and

Convergence of P_t

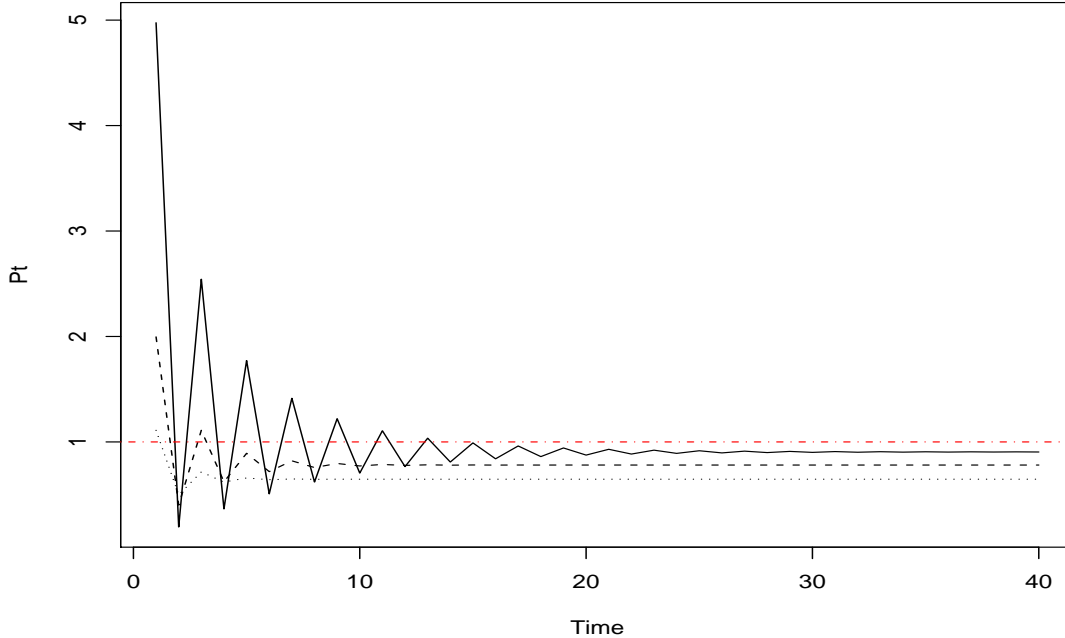


Figure 2: Rate of convergence for the sequence $\{P_t\}$ of Theorem 1; the solid line plots $\{P_t\}$ for $\delta = 0.2$, the dashed line plots $\{P_t\}$ for $\delta = 0.5$, the dotted line plots $\{P_t\}$ for $\delta = 0.9$ and the dashed/dotted line is the critical bound of 1.

Triantafyllopoulos³⁷. It is worthwhile noting that, given enough data in Phase I, the values of m_0 , P_0 and S_0 are not critical to the forecast performance, as in time series modelling prior information is deflated over time. This is indicated in Theorem 1 from the fact that P does not depend on P_0 . The value of δ can be critical in forecasting and a general recommendation is that several values of δ (in the range of $(0, 1)$) are applied in Phase I and according to the forecast performance (see Section 2) a value of δ is decided. One should note that high values of δ (e.g. $\delta = 0.9$) yield smooth forecasts with low forecast variances, but these forecasts are sometimes unable to forecast abrupt changes in the data; low values of δ (e.g. $\delta = 0.1$) yield more precise forecasts in the presence of “wild data”, but these forecasts come with increased forecast variances.

Our proposal for the modified EWMA control chart for the $LBF(t)$ process is motivated from the fact that the observations $LBF(t)$ possess autocorrelation and non-normality. The approach is model-based, and so a comparison with traditionally used multivariate control charts, such as the Hotelling’s T^2 and the M-EWMA (which are both data-based control charts), is difficult and in many occasions it can not give justice. Within the model-based control charting methods, it appears that our approach can be compared with the residual chart (Pan and Jarrett²⁴), but again the comparisons need to make sure that model uncertainty (whether for example the DWR is a good model or an alternative time series model performs better) should be ideally removed before any comparison is attempted. For example a miss-specification of a time series model might result to a false result in the comparison

of the competing control charts. From our experience the DWR works generally well (since it is a generalization of the Shewhart-Deming model), but this might not be the case for every multivariate process. We believe that such a comparison should deserve the length and the detail of a whole paper and thus here we do not pursue this project. Next we give two examples illustrating the design and application of the proposed control chart.

To the above we have assumed that given a process $\{y_t\}$ the interest is in building a control chart for monitoring simultaneously the process mean and the dispersion covariance matrix. However, in some cases the interest is placed on monitoring the dispersion covariance matrix only. In this case we can modify the control scheme by considering a modified EWMA control chart of the log-Bayes' factors of the first order difference process $z_t = y_t - y_{t-1}$, which from equation (2) has zero mean. Control charts based on $\{z_t\}$ will be more robust as compared to those for $\{y_t\}$, since the uncertainty of monitoring the process mean of $\{y_t\}$ has been removed.

4 London Metal Exchange Data

London metal exchange (LME) is the world's premier non-ferrous metals market trading currently aluminium, copper, lead and zinc, among other non-ferrous metals. Information on the LME and its functions can be found in its web site: <http://www.lme.co.uk>. The review of Watkins and McAleer⁴⁸ explores the recently growing literature on the LME market and Triantafyllopoulos³⁷ discusses the correlation of spot and future contract prices of aluminium based on the DWR model of Section 2. In this paper we discuss data of spot prices for the four metals aluminium (variable $\{y_{1t}\}$), copper (variable $\{y_{2t}\}$), lead (variable $\{y_{3t}\}$) and zinc (variable $\{y_{4t}\}$).

The data are collected from January 2005 until October 2005 for every trading day excluding weekends and bank holidays; Figure 3 plots the data. We form the observation vector $y_t = [y_{1t} \ y_{2t} \ y_{3t} \ y_{4t}]'$ and we are interested in knowing whether volatility is apparent, for $t = 151$ until $t = 220$. In other words we want to know whether from t to $t + 1$, the variability of the observations y_t and y_{t+1} has changed. This is a major concern to econometricians, because if there is evidence for volatility, this means there is uncertainty in investments and ideally the volatility should be understood and explained. In order to answer this important question we form the first order difference of the series $\{y_t\}$, defined by $x_t = y_t - y_{t-1}$, for $t > 1$ (Figure 4). Adopting the usual forecasting strategy of commodity forecasting, given data up to time $t - 1$, the forecast mean of y_t at time t is just the value of y_{t-1} and so we can write $\mathbb{E}(y_t|y^{t-1}) = y_{t-1}$. We note that the true mean of x_t may not be zero (unless in model (2) it is $\mu_t = \mu + \omega_t$), but it is true that conditionally on y^{t-1} or y_{t-1} we have $\mathbb{E}(x_t|y^{t-1}) = \mathbb{E}(y_t) - y_{t-1} = 0$, since $\mathbb{E}(y_t|y^{t-1}) = y_{t-1}$. From Figure 4 we observe that the series $\{x_t\}$ fluctuates around zero and volatility can be detected as significant deviations from the zero target; such deviations can be detected with the aid of a control chart of Section 3.

First we need to make sure that the DWR model fits the differenced series $\{x_t\}$ well. We take $t = 1 - 150$ as Phase I, in which the adequacy of the DWR model is evaluated. The performance statistics of Section 2 are: $MSSE = [0.993 \ 1.486 \ 0.866 \ 1.323]'$ and $MAE = [18.932 \ 45.187 \ 14.569 \ 19.082]'$, suggesting an acceptable fit. Of course the MAPE is not available, since $\{x_t\}$ is not a positive valued process (Section 2).

We have designed a modified EWMA control chart for the $LBF(t)$ of the process $\{x_t\}$ according to the discussion of Section 3. Figure 5 shows four control charts corresponding to

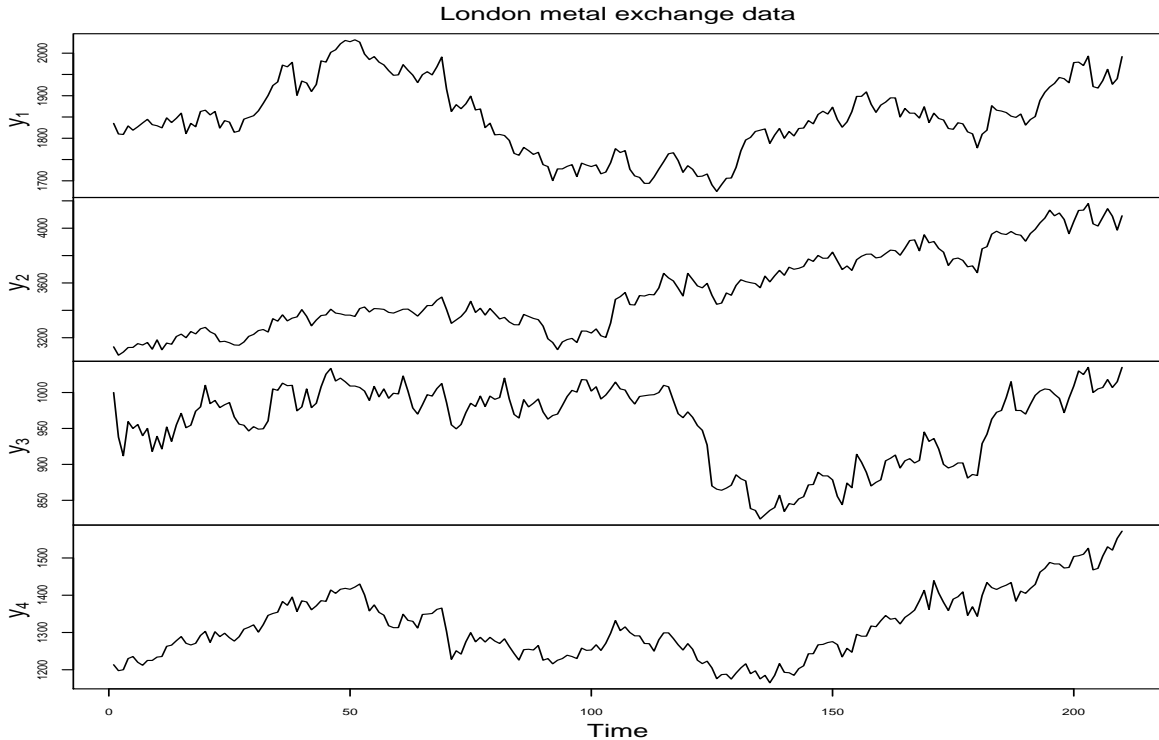


Figure 3: LME data $y_t = [y_{1t} \ y_{2t} \ y_{3t} \ y_{4t}]'$, consisting of aluminium ($\{y_{1t}\}$), copper ($\{y_{2t}\}$), lead ($\{y_{3t}\}$) and zinc ($\{y_{4t}\}$) spot prices (in US dollars per tonne of each metal).

four values of the EWMA smoothing parameter λ . Typically the control chart is robust to normality for small values of λ , but for these values the control chart is only detecting very small drifts in the mean this might not be desirable. As λ increases the modified EWMA control chart is losing its robustness over normality, but for symmetric process distributions, such as the empirical distribution of the $LBF(t)$ shown in Figure 1, the EWMA control chart might still be used for $\lambda = 0.5$. The correlation of the $LBF(t)$ is accounted by the autoregressive model of Section 3 and an analysis involving the data at Phase I shows that an the autoregressive parameter $\phi = 0.1$ is adequate to capture the autocorrelation of $LBF(t)$. According to Tables for the ARL of the modified EWMA control chart (see e.g. Shiau and Hsu⁴⁹) we choose the value of c in equation (9) so that $ARL = 370.4$, e.g. for $\lambda = 0.05$ and $\phi = 0.1$ we have $c = 2.469$. The remainder of the control limits are calculated as in equation (9).

Figure 5 shows that the process in Phase II appears to be in control, for $\lambda = 0.05$ and $\lambda = 0.1$, while for $\lambda = 0.2$ and $\lambda = 0.5$ the control chart returns an out of control point at $t = 172$ (with values $z_{172} = -1.852$ and $z_{172} = -2.999$, respectively). The mean of the EWMA z_t is slightly lower than zero, which indicates that, for the entire process $\{x_t\}$, there will be some deviation of the predictive density f_e from the target density f_e . It is up to the modeller to decide whether such deviation from the target distribution is worth of declaring the process out of control. In search of a more automatic approach, one can lift up the whole control chart so that in Phase I the mean of z_t is exactly zero. This can be performed automatically, in the end of Phase I, and this will declare the process in control in Phase II,

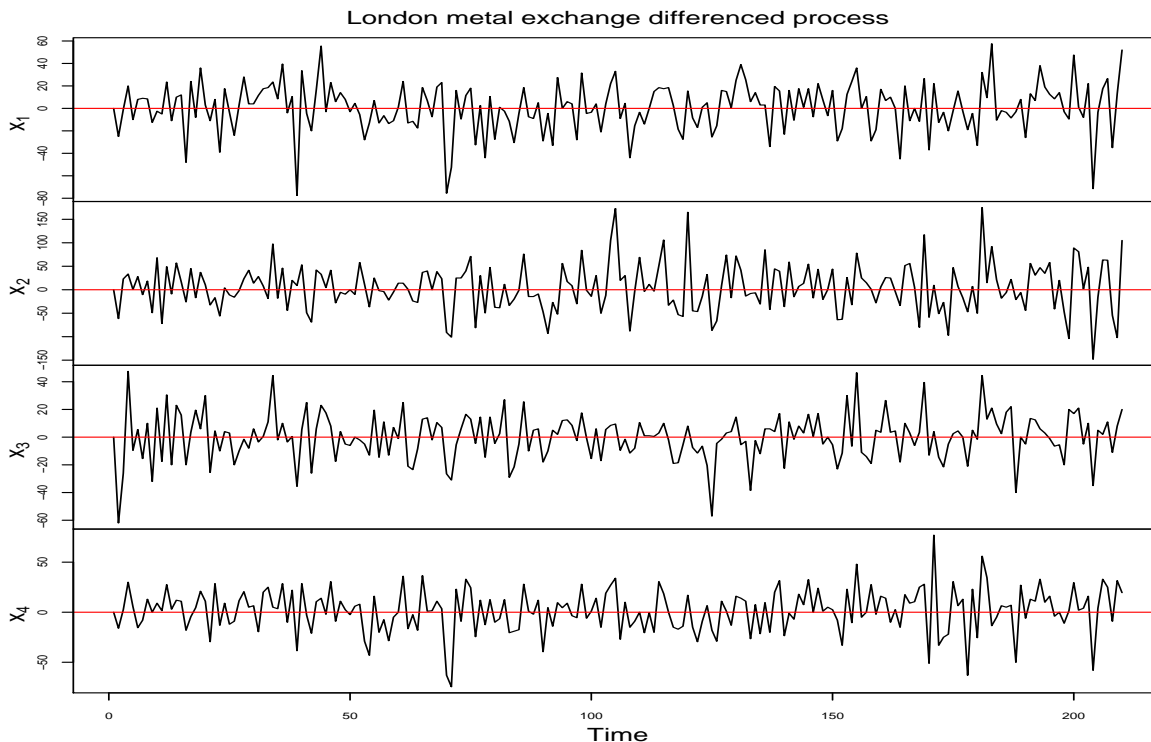


Figure 4: LME differenced process $x_t = [x_{1t} \ x_{2t} \ x_{3t} \ x_{4t}]'$, consisting of aluminium ($\{x_{1t}\}$), copper ($\{x_{2t}\}$), lead ($\{x_{3t}\}$) and zinc ($\{x_{4t}\}$). The horizontal lines, placed at zero, indicate no volatility.

for $\lambda = 0.05, 0.1$, while for $\lambda = 0.2, \lambda = 0.5$ there is an out of control point at $t = 172$. In Figure 5 the value of $\lambda = 0.5$ is rather high to ensuring correct control limits of the modified EWMA chart (see the relevant discussion in page 7); here the chart with $\lambda = 0.5$ is mainly shown for comparison purposes with the charts with lower values of λ , but in practice we suggest that λ does not exceed 0.2, unless there is strong evidence to support the assumption of normality for the distribution of $LBF(t)$. It is worth pointing out that the concentration of consecutive EWMA values under the mean in Phase II is causing warning, which is apparent in all charts. The phenomenon is more apparent in the charts for $\lambda = 0.05$ and $\lambda = 0.1$ and it can suggest the out of control state of the process at $t = 172$, which is apparent in the charts with $\lambda = 0.2$ and $\lambda = 0.5$. The interpretation of the out of control signal at $t = 172$ can not be done just by looking at Figure 4 and more dedicated methods of out of control variable identification need to be employed, see e.g. Bersimis *et al.*¹⁴.

5 Production Time Series Data

In an experiment of production of a plastic mould the quality is centered on the control of temperature and its variation. For this purpose five measurements of the temperature of the mould have been taken, for 276 time points. The experiment is fully described in Pan and Jarrett²⁴ and these authors show that this 5-dimensional production process $\{y_t\}$ is both autocorrelated and serially correlated including both vector autoregressive and moving aver-

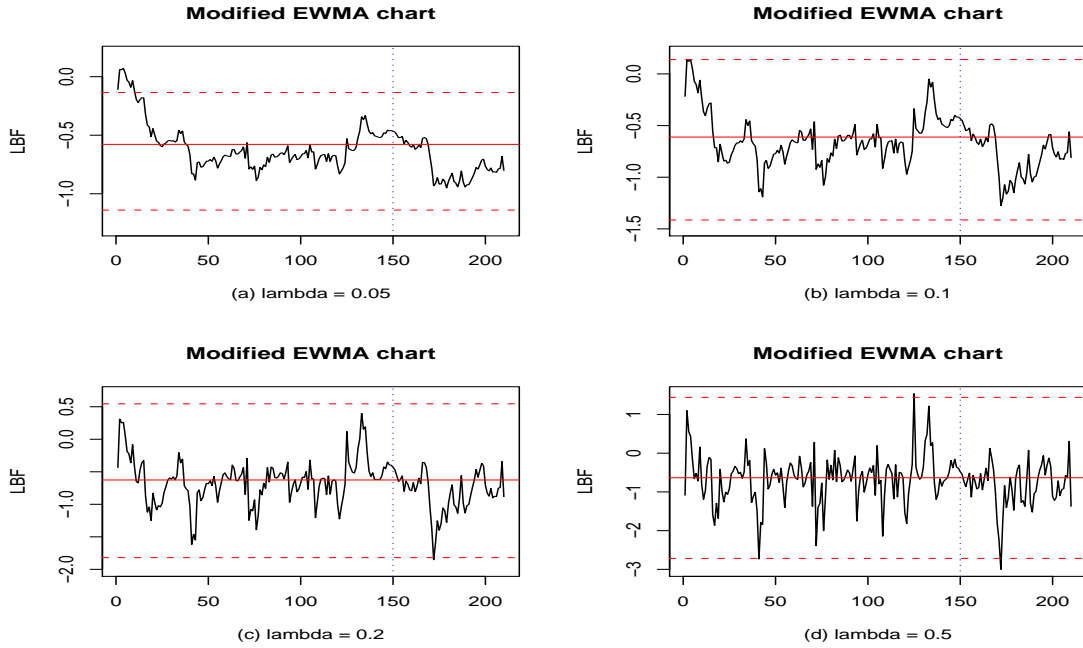


Figure 5: Modified EWMA control chart for the log Bayes' factor of the LME differenced process. Plots (a)-(d) show the modified control chart for different values of the smoothing parameter λ . In each plot of the panel, the solid horizontal line indicates the mean of the EWMA and the dotted horizontal lines indicate the control limits; the vertical line separates Phase I (for $t = 1 - 150$) and Phase II (for $t = 151 - 210$).

age terms. These authors use a vector state space charting approach based on the Hotelling control chart resulting on 12 out of control signals at Phase II (time points from $t = 181$ to $t = 220$) and hence concluding that the process falls badly out of control at Phase II.

We have used the data at Phase I (time points $t = 1 - 180$) in order to estimate the target mean vector $\mu = [208.245 \ 153.638 \ 53.063 \ -22.742 \ 16.126]'$ (as the average of each y_{it} : $t = 1 - 180$) and the dispersion covariance matrix

$$V = \begin{bmatrix} 0.168 & -0.001 & 0.633 & -0.438 & 0.015 \\ -0.001 & 0.023 & -0.017 & 0.006 & -0.002 \\ 0.633 & -0.017 & 25.621 & -15.658 & 0.453 \\ -0.438 & 0.006 & -15.658 & 14.181 & -0.596 \\ 0.015 & -0.002 & 0.453 & -0.596 & 0.951 \end{bmatrix}$$

(as the sample covariance matrix of each y_t : $t = 1 : 180$), where $y_t = [y_{1t}, y_{2t}, y_{3t}, y_{4t}, y_{5t}]'$. The DWR fits well with $MSSE = [0.855 \ 0.950 \ 0.992 \ 1.161 \ 0.996]'$, which is close to $[1 \ 1 \ 1 \ 1]$. The other two performance statistics are $MAE = [1.378 \ 0.899 \ 4.450 \ 3.316 \ 0.945]'$ and $MAPE = [0.007 \ 0.006 \ 0.089 \ -0.059]'$, where for $\{y_{4t}\}$ the “-” indicates that the MAPE is not available, since this variable is not positive valued (see the relevant discussion for MAPE in Section 2). The above performance statistics suggest that the model fit is good and therefore we can proceed with control charting at Phase II ($t = 181 - 279$).

The first thing to do is to find a suitable AR(1) model for the process $LBF(t)$. A suitable model is the AR(1): $LBF(t) = -4.624 + 0.062LBF(t - 1) + \nu_t$. According to the discussion

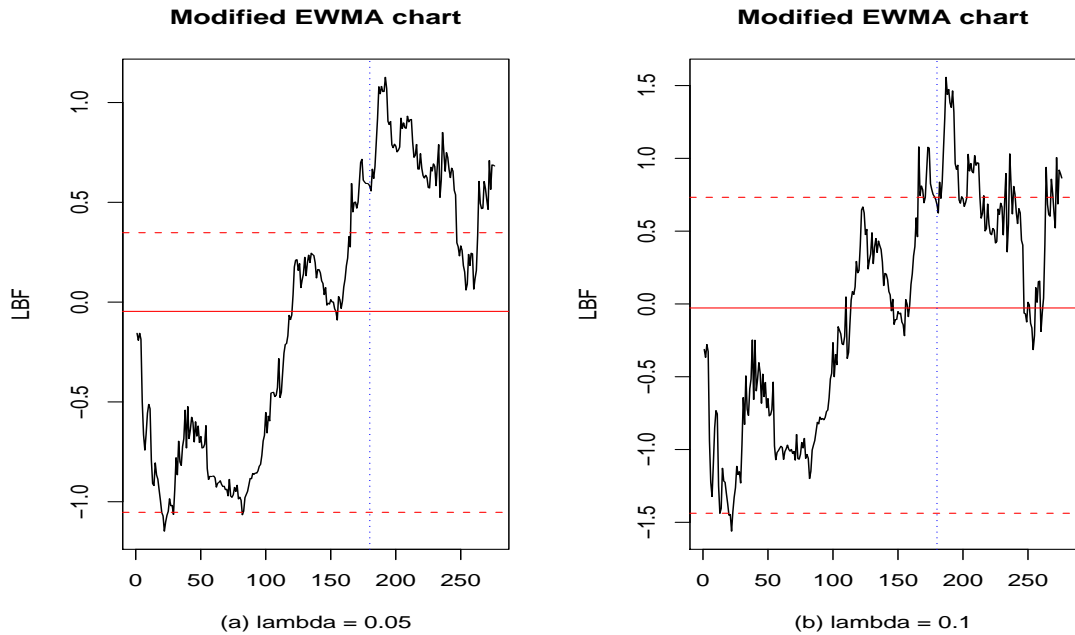


Figure 6: Modified EWMA control chart for the log Bayes' factor of the Production process. Plots (a)-(b) show two charts for values of the smoothing parameter $\lambda = 0.05$ and $\lambda = 0.1$. For both plots, the solid horizontal line indicates the target mean 0 and the dotted horizontal lines indicate the control limits; the solid vertical line separates Phase I (for $t = 1 - 180$) and Phase II (for $t = 181 - 276$).

above, we remove the intercept -4.624 so that we can obtain an in-control process in Phase I. Thus we design the modified EWMA control chart for $LBF(t) + 4.624$. Again we use tables for the modified EWMA control chart and for $\lambda = 0.05$ the resulting control chart is given in Figure 6. This figure agrees with the residual chart of Pan and Jarrett²⁴, that finds the process in Phase II out of control for most of the data points. In Phase I chart of panel (b) of Figure 6 gives one out of control point, which is in agreement with Pan and Jarrett²⁴, but in panel (a) of Figure 6 the control chart detects more out of control points in Phase I. The EWMA control chart is robust to non-normality for the low values of $\lambda = 0.05$ and $\lambda = 0.1$, but for $\lambda = 0.05$ the chart is more sensitive to small shifts in the mean of $LBF(t)$, resulting to the detection of out of control points in Phase I. Any out of control points in Phase I should be immediately investigated and usual SPC procedures of removing influence of these points in the calculation of the control limits should be applied (Montgomery¹).

6 Conclusions

This paper develops a new multivariate control chart based on Bayes' factors. This control chart is specifically aimed at multivariate autocorrelated and serially correlated processes. The general idea is to form a target distribution, to construct a predictive density with good forecast ability and then to apply a univariate control chart for the logarithm of the Bayes' factor of the predictive error density against the target error density. Although in this

paper, for simplicity, we have considered normal distributions for the target and the predictive densities, in general application the proposed control charts can be applied considering other densities too as long as they are available in analytic form.

We have restricted our discussion to the modified EWMA control chart, but other control charts such as the modified CUSUM and non-parametric control charts can be applied. A major advantage of our approach as compared to other multivariate control charts is that once we have obtained the log Bayes' factors we can apply any appropriate univariate control chart. A difficulty appears to be that the resulting Bayes' factors process is both autocorrelated and non-normal, but we believe the design of the proposed chart is a challenge that can attract and motivate further research in this so important area of statistical process control.

Acknowledgements

I should like to thank the editor Erik Mønness and two anonymous referees for making several valuable suggestions, which considerably improved the paper.

Appendix

Proof of Theorem 1. First we prove $S_t \xrightarrow{\mathcal{P}} \Sigma$. It suffices to prove that S_t is unbiased estimator and that its covariance matrix converges to zero. From equations (4) and (5) we obtain

$$\mathbb{E}(S_t) = \frac{1}{t} \sum_{i=1}^t \frac{\delta \mathbb{E}(e_i e_i')}{\delta + P_{i-1}} = \frac{1}{t} \sum_{i=1}^t \frac{\delta(\delta + P_{i-1})\Sigma}{(\delta + P_{i-1})\delta} = \frac{1}{t}(t\Sigma) = \Sigma$$

and so S_t is unbiased for Σ . For the convergence, let $\text{vech}(\cdot)$ denote the column stacking operator of a lower portion of a covariance matrix and let $\|\cdot\|$ denote a matrix norm defined in a suitable linear space. From equation (5) we have

$$\text{Var}\{\text{vech}(S_t)\} = \frac{1}{t^2} \sum_{i=1}^t \left(\frac{\delta}{\delta + P_{i-1}} \right)^2 \text{Var}\{\text{vech}(e_i e_i')\}. \quad (\text{A-1})$$

From equation (5) e_i follows a p -variate normal distribution and so by writing $e_i = [e_{i1} \ e_{i2} \ \dots \ e_{ip}]'$, we have that $\text{Cov}(e_{ij}, e_{ik}) = \mathbb{E}(e_{ij} e_{ik})$ are bounded, since these expectations are expressed as moments of the multivariate normal distribution (Triantafyllopoulos⁵⁰). Hence $\text{Var}\{\text{vech}(e_i e_i')\}$ has finite elements and so we can write $\|\text{Var}\{\text{vech}(e_i e_i')\}\| < M$, for some $M > 0$. For any $\epsilon > 0$ define $t_0 = \lceil \epsilon M \rceil$ (the integral part of ϵM). From $P_{i-1} > 0$ we have that $\delta/(\delta + P_{i-1}) < 1$, for all $i = 1, 2, \dots, t$. Then

$$\begin{aligned} \|\text{Var}\{\text{vech}(S_t)\}\| &= \frac{1}{t^2} \left\| \sum_{i=1}^t \left(\frac{\delta}{\delta + P_{i-1}} \right)^2 \text{Var}\{\text{vech}(e_i e_i')\} \right\| \\ &\leq \frac{M}{t^2} \left\| \sum_{i=1}^t \left(\frac{\delta}{\delta + P_{i-1}} \right)^2 \right\| \\ &\leq \frac{tM}{t^2} = \frac{M}{t} < \epsilon, \end{aligned}$$

for any $t > t_0$. This shows that $\lim_{t \rightarrow \infty} \text{Var}\{\text{vech}(S_t)\} = 0$ and so $S_t \xrightarrow{\mathcal{P}} \Sigma$.

Proceeding now with $\{P_t\}$ we show that $\{P_t\}$ is a Cauchy sequence in the real line and hence $\lim_{t \rightarrow \infty} P_t = P$ exists. To prove that $\{P_t\}$ is a Cauchy sequence, it suffices to prove that $\lim_{t \rightarrow \infty} |P_t - P_{t-1}| = 0$, where $|\cdot|$ denotes absolute value. First we show that exists positive integer t_0 such that for all $t > t_0$ it is $P_t < 1$. The proof of this is by contradiction. Suppose that for all t_0 exists $t > t_0$ such that $P_t \geq 1$. Without loss in generality take $t_0 = t^*$ and $P_{t^*} = 1$. Then we see that $P_{t^*+1} = 1/(\delta + P_{t^*}) = 1/(\delta + 1) < 1$, $P_{t^*+2} = 1/(\delta + P_{t^*+1}) = (\delta + 1)/(\delta^2 + \delta + 1) < 1$ and likewise $P_{t^*+k} < 1$, for all $k \geq 1$. So we can pick $t_0 = t^* + 1$ so that we can not find any $t > t_0$ with $P_t \geq 1$, which contradicts the hypothesis. Thus exists $t_0 > 0$ so that for all $t > 0$ it is $P_t < 1$. This in turn implies that

$$\delta + P_{t-1} > 1, \quad \forall t > t_0. \quad (\text{A-2})$$

From the definition of P_t of equation (3), we obtain

$$P_t - P_{t-1} = \frac{1}{\delta + P_{t-1}} - \frac{1}{\delta + P_{t-2}} = -\frac{P_{t-1} - P_{t-2}}{(\delta + P_{t-2})(\delta + P_{t-2})} = \dots = \frac{(-1)^{t-1}(P_1 - P_0)}{\prod_{i=1}^{t-1} (\delta + P_{t-i})(\delta + P_{t-i-1})}.$$

Now pick t_0 as in (A-2) and define $M = \min\{\delta + P_{t-1}, (\delta + P_{t-2})^2, \dots, (\delta + P_{t_0+1})^2\}$ so that $M > 1$. Then

$$|P_t - P_{t-1}| = \frac{|1 - \delta P_0 - P_0^2|}{\prod_{i=0}^{t_0} (\delta + P_i)^2 \prod_{i=1}^{t-t_0-2} (\delta + P_{t-1})(\delta + P_{t-i-1})} < \frac{|1 - \delta P_0 - P_0^2|}{\prod_{i=0}^{t_0} (\delta + P_i)^2 M^{t-t_0-1}} \rightarrow 0,$$

since $\lim_{t \rightarrow \infty} M^{t-t_0-1} = +\infty$. This proves that $\lim_{t \rightarrow \infty} |P_t - P_{t-1}| = 0$ and so $\{P_t\}$ is a Cauchy sequence. Thus $\lim_{t \rightarrow \infty} P_t = P$ exists and from equation (3) we have $P = 1/(\delta + P)$, for which we derive $P = (\sqrt{\delta^2 + 4} - \delta)/2$, after rejecting the negative root $P = (-\sqrt{\delta^2 + 4} - \delta)/2$. \square

References

- [1] Montgomery DC. *Introduction to Statistical Quality Control*. Wiley, 4th edition: New York, 2000.
- [2] Box GEP, Luceño A. *Statistical Control by Monitoring and Feedback Adjustment*. Wiley: New York, 1997.
- [3] Del Castillo E. *Statistical Process Adjustment for Quality Control*. Wiley: New York, 2002.
- [4] Tracy ND, Young, JC, Mason RL. Multivariate control charts for individual observations. *Journal of Quality Technology* 1992 **24**: 88-95.
- [5] Liu RY. Control charts for multivariate processes. *Journal of the American Statistical Association* 1995 **90**: 1380-1387.
- [6] Kourti T, MacGregor JF. Multivariate SPC methods for process and product monitoring. *Journal of Quality Technology* 1996 **28**: 409-428.
- [7] Mason RL, Chou YM, Young JC. Applying Hotelling's T-2 statistic to batch process. *Journal of Quality Technology* 2001 **33**: 466-479.
- [8] Vargas NJA. Robust estimation in multivariate control charts for individual observations. *Journal of Quality Technology* 2003 **35**: 367-376.

- [9] Ye N, Borror CM, Parmar D. Scalable chi-square distance versus conventional statistical distance for process monitoring with uncorrelated data variables. *Quality and Reliability Engineering International* 2003 **19**: 505-515.
- [10] Pan X. An alternative approach to multivariate EWMA control chart. *Journal of Applied Statistics* 2005 **32**: 695-705.
- [11] Lowry CA, Montgomery DC. A review of multivariate control charts. *IIE Transactions* 1995 **27**: 800-810.
- [12] Sullivan JH, Woodall WH. A comparison of multivariate control charts for individual observations. *Journal of Quality Technology* 1996 **28**: 398-408.
- [13] Montgomery DC, Woodall WH. A discussion on statistically-based process monitoring and control. *Journal of Quality Technology* 1997 **29**: 157-162.
- [14] Bersimis S, Psarakis S, Panaretos J. Multivariate statistical process control charts: an overview. *Quality and Reliability Engineering International* 2006 (to appear).
- [15] Yeh, AB, Lin, DK-J, McGrath, RN. Multivariate control charts for monitoring covariance matrix: a review. *Quality Technology and Quantitative Management* 2006 (to appear).
- [16] Yeh AB, Lin DKJ, Zhou H, Venkataramani C. A multivariate exponentially weighted moving average control chart for monitoring process variability. *Journal of Applied Statistics* 2003 **30**: 507-536.
- [17] Surtihadi J, Raghavachari M, Runger G. Multivariate control charts for process dispersion. *International Journal of Production Research* 2004 **42**: 2993-3009.
- [18] Cheng, SW, Thaga, K. Multivariate max-CUSUM chart. *Quality Technology and Quantitative Management* 2005 **2**: 221-235.
- [19] Costa AFB, Rahim MA. Monitoring Process Mean and Variability with One Non-central Chi-square Chart. *Journal of Applied Statistics* 2004 **31**: 1171-1183.
- [20] Dyer JN, Conerly MD, Adams BM. A simulation study and evaluation of multivariate forecast based control charts applied to ARMA processes. *Journal of Statistical Computation and Simulation* 2003 **73**: 709-724.
- [21] Jiang W. Multivariate control charts for monitoring autocorrelated processes. *Journal of Quality Technology* 2004 **36**: 367-379.
- [22] Kalgonda, AA, Kulkarni, SR. Multivariate quality control chart for autocorrelated processes. *Journal of Applied Statistics* 2004 **31**: 317-327.
- [23] Noorossana R, Vaghefi SJM. Effect of autocorrelation on performance of the MCUSUM control chart. *Quality and Reliability Engineering International* 2006 DOI: 10.1002/qre.695
- [24] Pan X, Jarrett J. Applying state space to SPC: monitoring multivariate time series. *Journal of Applied Statistics* 2004 **31**: 397-418.
- [25] Tagaras G. A survey of recent developments in the design of adaptive control charts. *Journal of Quality Technology* 1998 **30**: 212-231.

- [26] Tagaras G, Nikolaidis Y. Comparing the effectiveness of various Bayesian x control charts. *Operations Research* 2002 **50**: 878-888.
- [27] De Magalhães MS, Costa AFB, Neto FDM. Adaptive control charts: a Markovian approach for processes subject to independent disturbances. *International Journal of Production Economics* 2006 **99**: 236-246.
- [28] West M, Harrison PJ. *Bayesian Forecasting and Dynamic Models* (2nd edn). Springer: New York, 1997.
- [29] Deming WE. *Out of the Crisis*. Massachusetts Institute of Technology Center for Advanced Engineering Study: Cambridge, MA, 1986.
- [30] Triantafyllopoulos K, Godolphin JD, Godolphin EJ. Process improvement in the micro-electronic industry by state space modelling. *Quality and Reliability Engineering International* 2005 **21**: 465-475.
- [31] Durbin J, Koopman SJ. *Time Series Analysis by State Space Methods*. Oxford University Press: Oxford, 2001.
- [32] Brown RG. *Smoothing, Forecasting and Prediction of Discrete Time Series*. Englewood Cliffs, Prentice Hall: New Jersey, 1962.
- [33] Ameen JRM, Harrison PJ. Discount weighted estimation. *Journal of Forecasting* 1984 **3**: 285-296.
- [34] Ameen JRM. Sequential discount estimation. *The Statistician* 1988 **37**: 227-237.
- [35] Goodwin P. Adjusting judgemental extrapolations using Theil's method and discounted weighted regression. *Journal of Forecasting* 1997 **16**: 37-46.
- [36] Triantafyllopoulos K, Pikoulas J. Multivariate Bayesian regression applied to the problem of network security. *Journal of Forecasting* 2002 **21**: 579-594.
- [37] Triantafyllopoulos K. Multivariate discount weighted regression and local level models. *Computational Statistics and Data Analysis* 2006 DOI: 10.1016/j.csda.2005.07.003 (in press).
- [38] Chatfield C. *Time-Series Forecasting*. Chapman and Hall: New York, 2001.
- [39] Gupta AK, Nagar DK. *Matrix Variate Distributions*. Chapman and Hall: New York, 1999.
- [40] Salvador M, Gargallo P. Automatic monitoring and intervention in multivariate dynamic linear models. *Computational Statistics and Data Analysis* 2004 **47**: 401-431.
- [41] Vasilopoulos, AV, Stamboulis, AP. Modification of control chart limits in the presence of correlation. *Journal of Quality Technology* 1978 **10**: 20-30.
- [42] Schmid, W. On the run length of a Shewhart chart for correlated data. *Statistical Papers* 1995 **36**: 111-130.

- [43] Schmid, W. On EWMA charts for time series. In *Frontiers in Statistical Quality Control* 1997 **5**: 114-137.
- [44] VanBrackle, LN, Reynolds, MR. EWMA and CUSUM control charts in the presence of autocorrelation. *Communications in Statistics: Simulation and Computation* 1997 **26**: 979-1008.
- [45] Harris, TJ, Ross, WH. Statistical process control procedures for correlated observations. *Canadian Journal of Chemical Engineering* 1991 **69**: 48-57.
- [46] Borrer, CM, Champ, CW, Ridgon, SE. Poisson EWMA control charts. *Journal of Quality Technology* 1998 **30**: 352-361.
- [47] Maravelakis, PE, Panaretos, J, Psarakis, S. An examination of the robustness to non normality of the EWMA control charts for the dispersion. *Communications in Statistics: Simulation and Computation* 2005 **34**: 1069-1079
- [48] Watkins C, McAleer M. Econometric modelling of non-ferrous metal prices. *Journal of Economic Surveys* 2004 **18**: 651-701.
- [49] Shiau, J-JH, Hsu, Y-C. Robustness of the EWMA control chart to non-normality for autocorrelated processes. *Quality Technology and Quantitative Management* 2005 **2**: 125-146.
- [50] Triantafyllopoulos, K. On the central moments of the multidimensional Gaussian distribution. *Mathematical Scientist* 2003 **28**: 125-128.